

WASHER WITH LEADWIRE AND ARMOR

How to build a part number:

To order an Applied Sensor Technologies temperature sensor, select the requirements for the categories listed below and fill in the corresponding boxes with your selection. Don't see exactly what you need? Give us a call!

SENSOR TYPE	ASSEMBLY STYLE	WASHER SIZE	MATERIAL	CALIBRATION	HOT JUNCTION	SHEATH LENGTH	ARMOR CABLE LENGTH	OPTIONS

SENSOR TYPE*

GP – General purpose thermocouple

MI – Mineral insulated thermocouple

ASSEMBLY STYLE

32 – Washer with leadwire; fiberglass insulated conductors; fiberglass jacket; armor cable; stainless steel washer thickness 1/4" (0.250); sheath diameter 0.188" only

WASHER SIZE (in inches)

FOR BOLT SIZE	ID	OD
6 – 3/16 (0.188)	0.193	0.375
7 – 1/4 (0.250)	0.255	0.500
9 – 3/8 (0.375)	0.380	0.750
10 – 1/2 (0.500)	0.510	1.000

WASHER AND SHEATH MATERIAL

3 – 316 stainless steel

CALIBRATION Standard limits

J – Single J **JJ** – Dual J

K – Single K **KK** – Dual K

T – Single T **TT** – Dual T

E – Single E **EE** – Dual E

Special limits are available – consult AST

HOT JUNCTION

G – Grounded junction

U – Ungrounded junction

SHEATH LENGTH (Note: maximum L=96" for GP; for MI, lengths over L84 will be shipped coiled unless otherwise specified)


L# – (e.g., L6 = 6 inch sheath, L12.5 = 12.5 inch length)

ARMOR CABLE LENGTH

X# – (e.g., X72 = 72 inch length)

OPTIONS – see page 1-18b

*Note: GP thermocouples, manufactured using hollow tubing and wire, tend to be lower cost than MI, but cannot be bent in the field and are standardly designed for sensing temperatures below 500°F. MI thermocouples are more rugged than GP due to compacted magnesium-oxide powder insulation, can be bent in the field, and are appropriate for the temperature range of the sensor and sheath.

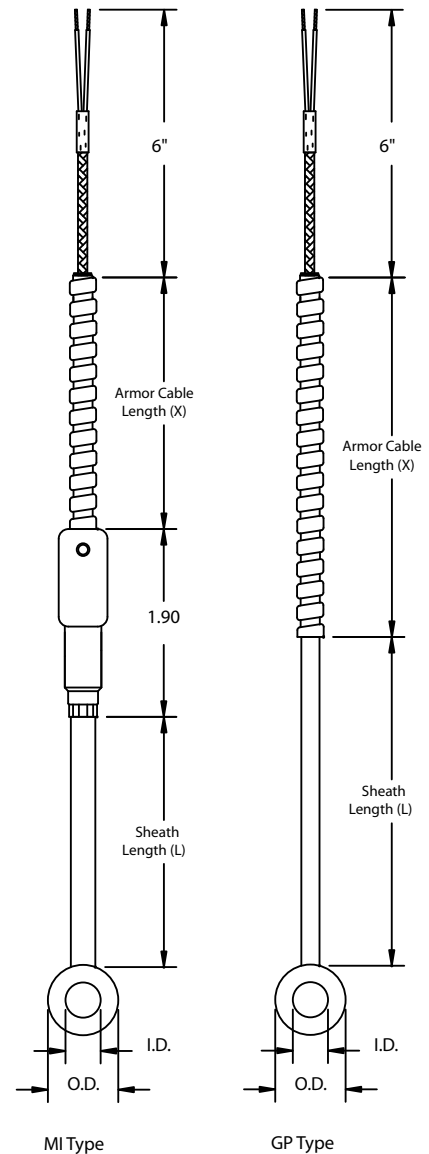

STYLE 32

AVAILABLE OPTIONS and MODIFICATIONS

ASSEMBLY OPTIONS	
Option Code	Description
TAG1	Stainless steel tag and wire
B90-	90° bend in sheath [specify length from tip in inches e.g., B90-6]
B45-	45° bend in sheath (specify length from tip in inches e.g., B45-6)
CAL1	NIST traceable calibration [specify point(s)]
CRT1	Certificate of conformance
HT10	High temperature (900°F) transition. (Standard transition rated 500°F/260°C)

WIRING CONNECTION OPTIONS	
Option Code	Description
WC76	#6 spade terminals, plated copper
WC70	#10 spade terminals, plated copper
WC84	1/4" push-on insulated terminals, plated copper
WC90	#10 ring terminals
WC98	#8 ring terminals
PLUGS AND JACKS (Note: plug is designed to be attached to sensor assemblies. Jack options – for customer wiring – should only be specified if plug option is also included. Cable clamp is included for both plug and jack options.)	
PJ10	Standard plug, rated to 177°C (350°F)
PJ20	Standard jack, rated to 177°C (350°F)
PJ30	Miniature plug, rated to 177°C (350°F)
PJ40	Miniature jack, rated to 177°C (350°F)
PJ50	High temp. plug, rated to 260°C (500°F)
PJ60	High temp. jack, rated to 260°C (500°F)
BX CONNECTORS	
WC40	1/2"
WC50	3/4"

EXTENSION WIRE

A selection of extension-grade thermocouple wire is available to connect the sensor to its input device. Consult Accessories section.